
LAZER
HIGH PERFORMANCE LIGHTING

JEEP WRANGLER / GLADIATOR (2018+)
A-PILLAR MOUNTING KIT





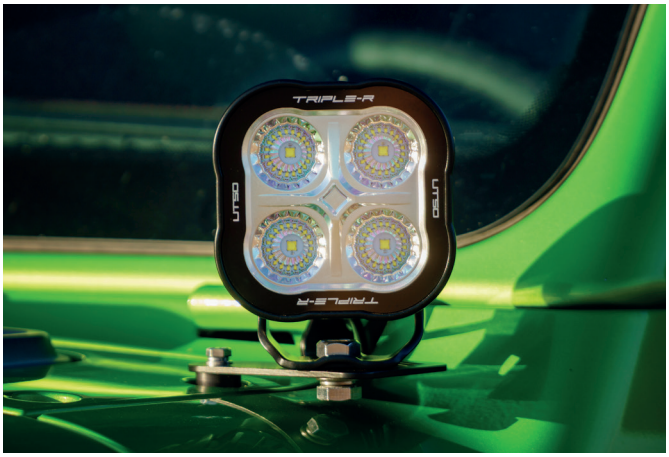

+44 (0)1992 677374
sales@lazerlamps.com
Calder House, Central Road
Harlow, Essex, CM20 2ST. UK.

WWW.LAZERLAMPS.COM

MADE IN THE UK /LAZERLAMPS

WHAT'S INCLUDED

- 2x A Pillar Mounting Brackets
- Fixtures
- Fitting Instructions

TOOLS REQUIRED

- Ratchet
- 6" Extension
- T40/T50 Torx

PRE-INSTALLATION CHECKS

Ensure all vehicle systems are fully operational prior to install, and directly afterwards.

Ensure battery is disconnected.

MOUNTING BRACKET INSTALLATION

UTILITY-50 shown for illustration purposes.



STEP 1


Remove Windshield Hinge Bolt with T50 Torx.

STEP 2

Remove the 4x T40 Torx bolts holding the fender cowl on (Do Not Discard).





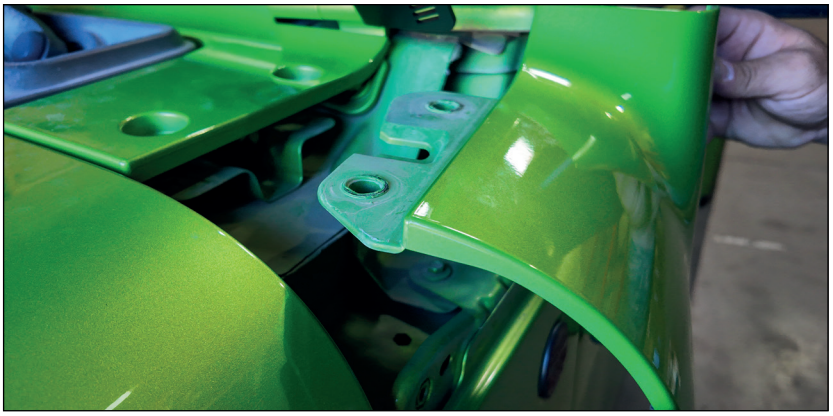

STEP 3

Carefully pull out the fender cowl and set aside.

STEP 4

Mount your light to the A-pillar Bracket. Ensure correct bolt orientation so hardware does not contact the paint.







STEP 5

Mount light and bracket to the windshield hinge loosely with the OE Hardware.




STEP 6

Ensure wiring is run correctly through so the fender cowl does not pinch wire when replaced.



STEP 7

Place fender cowl back into place and secure 2x T40 Torxbolts on the side and 1x T40 Torxbolt on the top most forward hole.

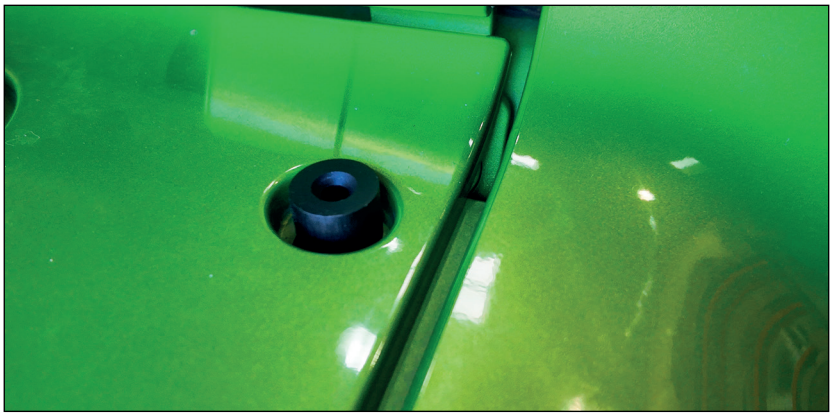

STEP 8

Place the spacer into the open fender cowl location.



STEP 9

Pivot lights and insert the provided Hardware.

Tighten provided hardware and 1x Torx T50 Hardware.



STEP 10

Adjust the lights to desired direction and tighten the hardware.

STEP 11

Run wiring to desired switch. It is recommended to use the available corresponding Lazer wiring kit for your product (please refer to the wiring kit product page for further wiring instructions).